

**Tomasz Stoeck**

Dr inż.

Zachodniopomorski Uniwersytet Technologiczny  
w Szczecinie, Wydział Inżynierii Mechanicznej  
i Mechatroniki, Katedra Eksploatacji Pojazdów  
Samochodowych

ORCID: 0000-0002-4286-2747

tstoeck@wp.pl

DOI: 10.35117/A\_ENG\_23\_09\_10\_03


**Evaluation of regenerative capabilities of piezoelectric fuel injectors**

**Abstract:** The article presents the issue of regeneration of injectors with a piezoelectric actuator, taking into account existing limitations and the availability of original spare parts. The scope of required maintenance activities by leading fuel equipment manufacturers was compared, as well as the types of diagnostic tests conducted in separate laboratory facilities. Examples of measuring devices that should be standard and optional equipment in workshops operating in this service sector were provided. Through our own research, it was demonstrated that this process can be effectively carried out, even when there is a need to expand existing production procedures. Improving the efficiency of these repairs aligns with environmentally friendly practices, as extending the product lifecycle is in line with the concept of sustainable development. Furthermore, the technology that replaces first and second-generation electromagnetic injectors is supported, and its application has a direct impact on increasing fuel dosage precision, achieving faster response to changing driving conditions, as well as enhancing the durability and reliability of modern automotive engines. This is particularly important in the transportation services sector, where in addition to the need for reducing harmful impact on the environment, economic considerations are also crucial.

**Keywords:** Piezoelectric fuel injectors; Diagnostic process; Regeneration.

**Introduction**

In recent years, there has been increased interest in diversifying the fleet of motor vehicles used in transportation and commercial purposes. This is mainly due to the introduction of very strict emission standards, as well as technological advancements in the area of alternative propulsion sources. However, the decarbonization of this sector is progressing very slowly, and it is difficult to expect a radical change in the near future. For example, in European Union countries, the combined share of commercial vehicles equipped with compression ignition engines is 93.3% (Figure 1) [2]. The majority of these vehicles use common rail fuel systems, which have displaced other fuel delivery systems due to their optimal fuel injection process shaping, thereby ensuring proper fuel-air mixture preparation and combustion process [1, 11, 12]. Subsequent generations of these systems have significantly improved their dynamic parameters, as well as achieved tangible benefits in reducing fuel consumption, noise emissions, and harmful substances [10, 18, 19]. However, meeting these requirements has necessitated the use of piezoelectric injectors gradually replacing solutions with traditional electromagnetic coils, allowing for more flexible control of multiphase fuel atomization and adaptation to increasingly higher operating pressures [4, 5, 8].

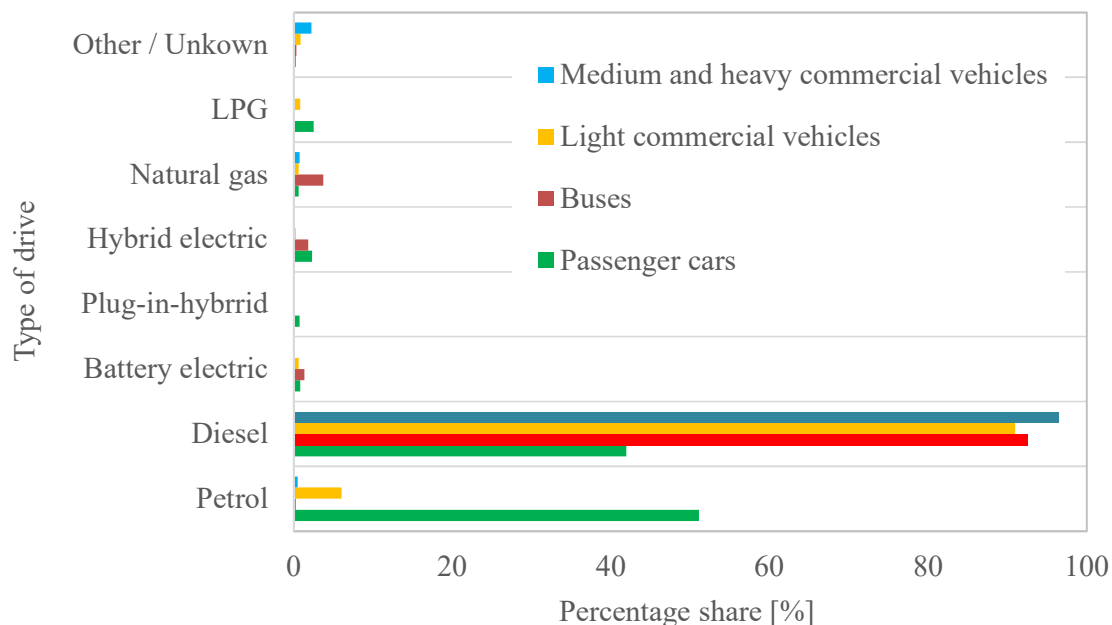


### 1. Types of vehicle propulsion systems in European Union countries

*Source: own study based on [2]*

Transportation services are associated with the costs of operating a vehicle fleet, which directly impact the profitability of the business [3]. As a result, there is a growing interest in the regeneration of components of fuel injection systems, as this process allows for restoring their factory performance parameters. Among the undeniable advantages are also the relatively short vehicle downtime, warranty provided by the service workshop, and significant reduction in expenses compared to the use of new products [16]. For these reasons, the article presents the contemporary repair possibilities for piezoelectric injectors, which have not been supported by manufacturers for a long time. In the absence of original spare parts, their maintenance was limited to cleaning, diagnostic testing, and, if necessary, replacing the nozzle (needle with a sprayer) for selected reference numbers. Currently, the situation has somewhat improved, mainly due to specially dedicated measurement equipment and partial access to substitutes.

#### Contemporary diagnostic stations

All examinations of fuel systems that require the disassembly of their executive components from the engine are classified as invasive methods. Among these methods, the most precise and reliable way to control the technical condition of injectors is through tests conducted on specially dedicated test benches. These are universal station devices equipped with single or multiple measurement circuit systems. They are available in compact versions (Figure 2), as well as modular constructions (Figure 3), allowing for the installation of additional equipment in line with the workshop's profile and capabilities. The benches are equipped with necessary adapters and connections for the installation of hydraulic and electrical lines to the injector. This enables not only comprehensive testing but also internal cleaning, which involves a thermochemical flushing process with high-pressure and elevated temperature detergent.

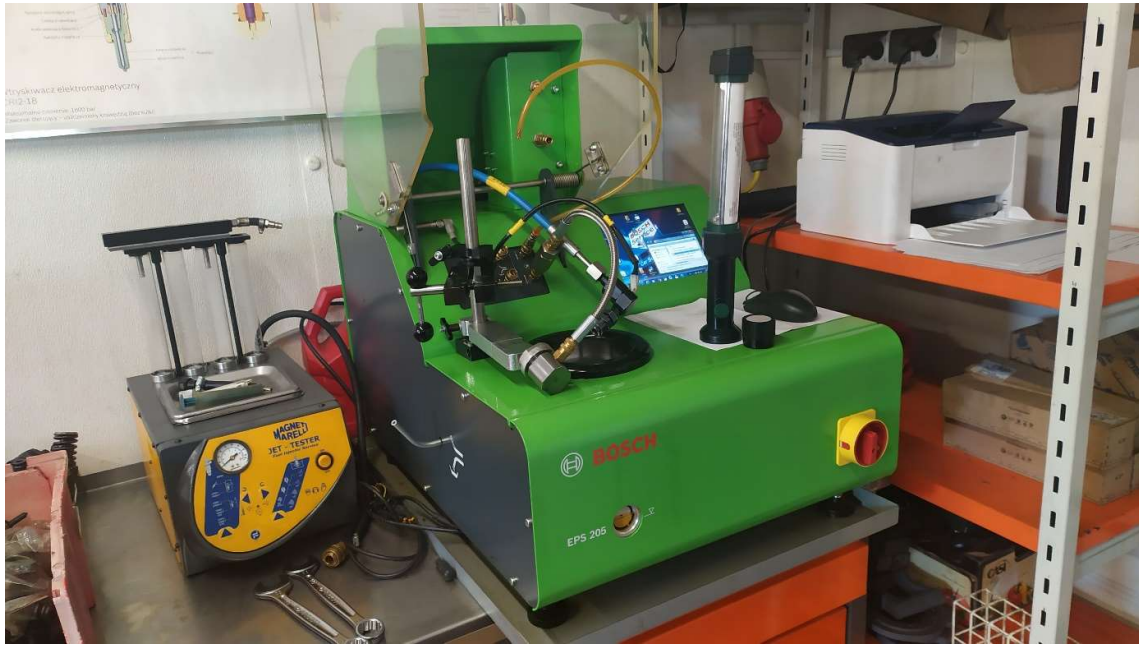

2. Compact test bench EPS 205 (Bosch)

*Source: own study*




3. Modular test station STPIW-3 (Autoelektronika Kędzia)

*Source: own study*

The technical condition is assessed based on approved procedures, including electrical, leak, nozzle opening pressure tests, etc. Any deviations detected in these tests immediately result in the discontinuation of the initial testing phase. In the case of positive results, flow measurements are conducted at various activation times and operating pressures. Typically, these measurements are performed in automatic cycles or less frequently with manual adjustments, where the quantity of individual doses and corresponding return flows are checked at several operating points, thus simulating changing engine load conditions. The results are

compared with the manufacturer's database available from the test device, then recorded and printed as a measurement report. Exceeding the limit values constitutes the basis for disassembling the injector into its components.

Examinations under high magnification aim to determine the degree of wear and detect any potential malfunctions in the components that are part of the executive and control assemblies. These examinations are carried out on separate laboratory stations equipped with an optical stereoscopic microscope capable of digital image recording or an industrial camera (Figure 4). In standard procedures, it is assumed that visual inspections precede the stages of cleaning individual components in ultrasonic cleaners and their thorough drying with compressed air. However, this sequence may change in situations where there is a reasonable suspicion of the presence of metal filings that enter the fuel system from a faulty fuel pump.

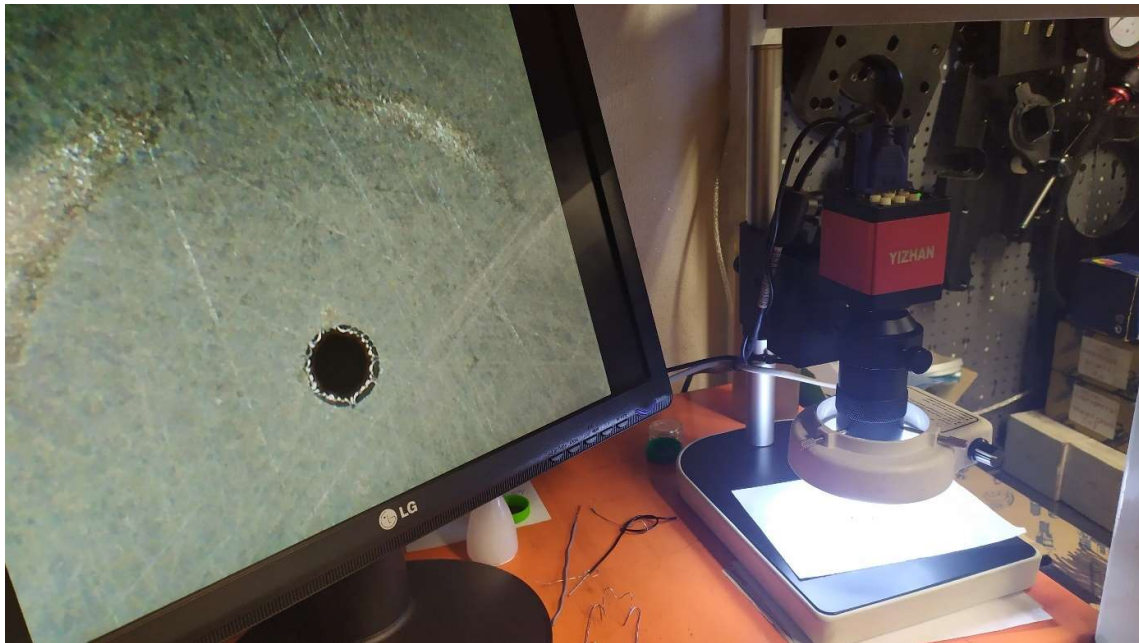


4. Microscopic inspection using Yizhan 13MP HDMI VGA industrial camera  
*Source: own study*

Another group comprises optional testing equipment that assists the fundamental diagnostic process. In the case of piezoelectric injectors, probes are extremely useful as they enable expanded measurements of the actuator and precise determination of its technical condition (Figure 5). Another example is leak testers, which are useful for detecting leaks within the overflow pipe and nozzle (Figure 6). By applying a control pulse from an additional device, it is also possible to assess fuel atomization quality, nozzle opening time, etc.



5. Electrical measurements of Denso G2P injector on Mega Tester V3 probe  
*Source: own study*

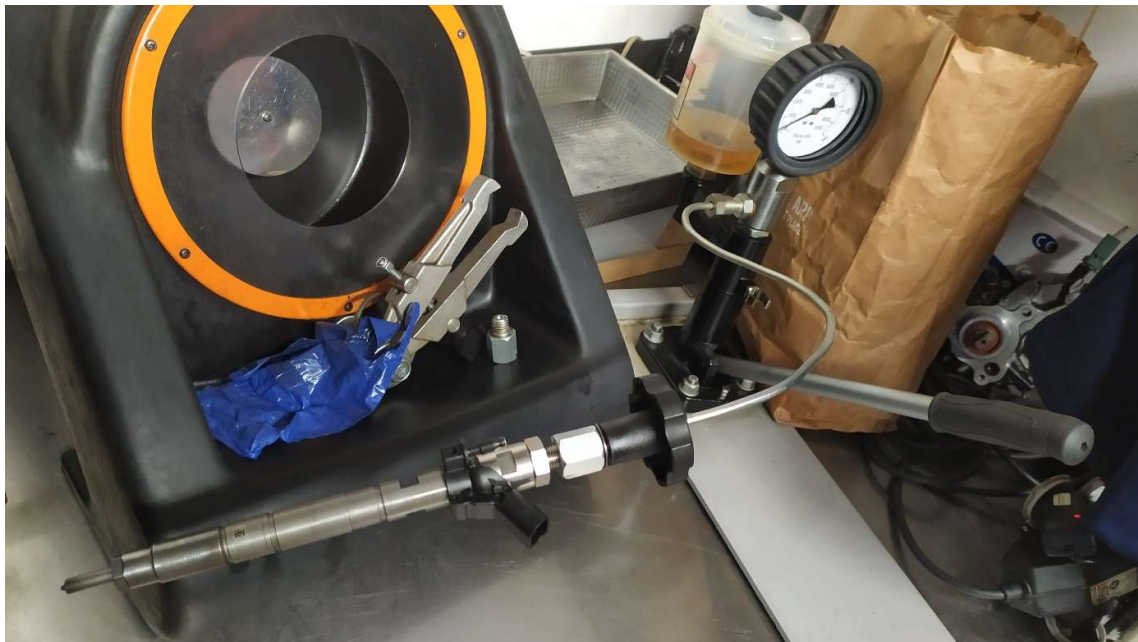

6. Injector leak testing with Bass BP-3605 tester  
*Source: own study*

### **The course of the injector regeneration process**

Table 1 presents a comparison of diagnostic and service procedures carried out in the process of regeneration of piezoelectric injectors. It can be observed that the procedures of individual manufacturers are similar to each other and differ in a few aspects. First and foremost, Siemens VDO Continental products require the adjustment of the air gap, referred to as GAP, located between the actuator and the hydraulic transducer (Figure 7). This is due to their specific construction, as the stack of crystals is not placed inside the main body but is attached to it using

a nut. On the other hand, the optional revitalization process, involving the removal of short circuits between individual layers, is not conducted for Delphi products. Unlike other manufacturers, Denso injectors, in addition to assigning new codes and entering them into the engine control module, require an additional calibration of zero doses. During this time, the system performs self-diagnostics to check the fuel delivery method at different operating pressures and actuation times.

**Tab. 1.** Comparison of diagnostic and service procedures among selected manufacturers

*Source: own study*

Type of activity	Injector manufacturer			
	Bosch	Siemens VDO Continental	Denso	Delphi
Inspection and verification	•	•	•	•
Electrical testing	•	•	•	•
Internal cleaning (thermochemical)	•	•	•	•
Leakage testing	•	•	•	•
Spray pattern testing	•	•	•	•
<b>Preliminary flow testing</b>	•	•	•	•
Disassembly	•	•	•	•
Ultrasonic cleaning of parts	•	•	•	•
Microscopic inspection	•	•	•	•
Replacement of parts with new ones	•	•	•	•
Assembly	•	•	•	•
Air gap adjustment (GAP)		•		
<b>Main flow testing</b>	•	•	•	•
Crystal stack revitalization (optional)	•	•	•	
Injector coding	•	•	•	•
Zero calibration on the engine			•	



7. Adjustment of the air gap (GAP) in Siemens VDO Continental injectors

*Source: own study*

Unfortunately, access to specialized equipment and dedicated tools does not always translate into the effectiveness of the regeneration process. The main problem is the lack of spare parts (Table 2). Firstly, most manufacturers do not offer the replacement of the piezoelectric stack, which is why the technology behind this process has not been made available. An exception to this is the substitutes for Siemens VDO Continental injectors, which can be obtained in the primary market. Such actuators are referred to as solenoids, as their disassembly method is analogous to electromagnetically controlled constructions (Figure 8). Secondly, the remaining executive components are completely disassemblable, allowing for thorough cleaning in ultrasonic baths and microscopic inspections. However, identifying damage outside of the nozzle (needle and atomizer) becomes problematic in the case of Denso and Delphi products. In individual cases, used parts can be used, which come from injectors previously deemed irreparable, usually due to crystal damage. These parts are often left by customers themselves or obtained through other means, such as from collaborating auto repair shops, purchased online in the secondary market, etc. However, this process, referred to in the literature as cannibalization, is difficult to consider as a comprehensive solution when considering the actual scale of demand for regeneration services.

**Tab. 2.** Comparison of parts replacement capabilities among selected manufacturers

*Source: own study*

Type of component	Injector manufacturer			
	Bosch	Siemens VDO Continental	Denso	Delphi
Nozzle	•	•	•	•
Valve	•	•		
Hydraulic amplifier	•	•		
Piezoelectric crystal stack		•		




8. Disassembled injector actuator 2.3 PCR from Siemens VDO Continental

*Source: own study*

#### **Example of own research**

Based on years of laboratory-workshop practice, it is evident that even the availability of spare parts may prove insufficient for a successful regeneration process. Prolonged usage leads to a decrease in the initial extension of the stack and its impact on the actuating components. This is due to the degradation of crystal properties resulting from the aging process [6, 14, 15]. As an example, our own study involved the Bosch CRI3-16 injector, which was disassembled from a 2.0 dCi Nissan X-Trail engine with a mileage of 322,000 km. Figure 9 illustrates its internal structure, highlighting the key control and actuating elements.



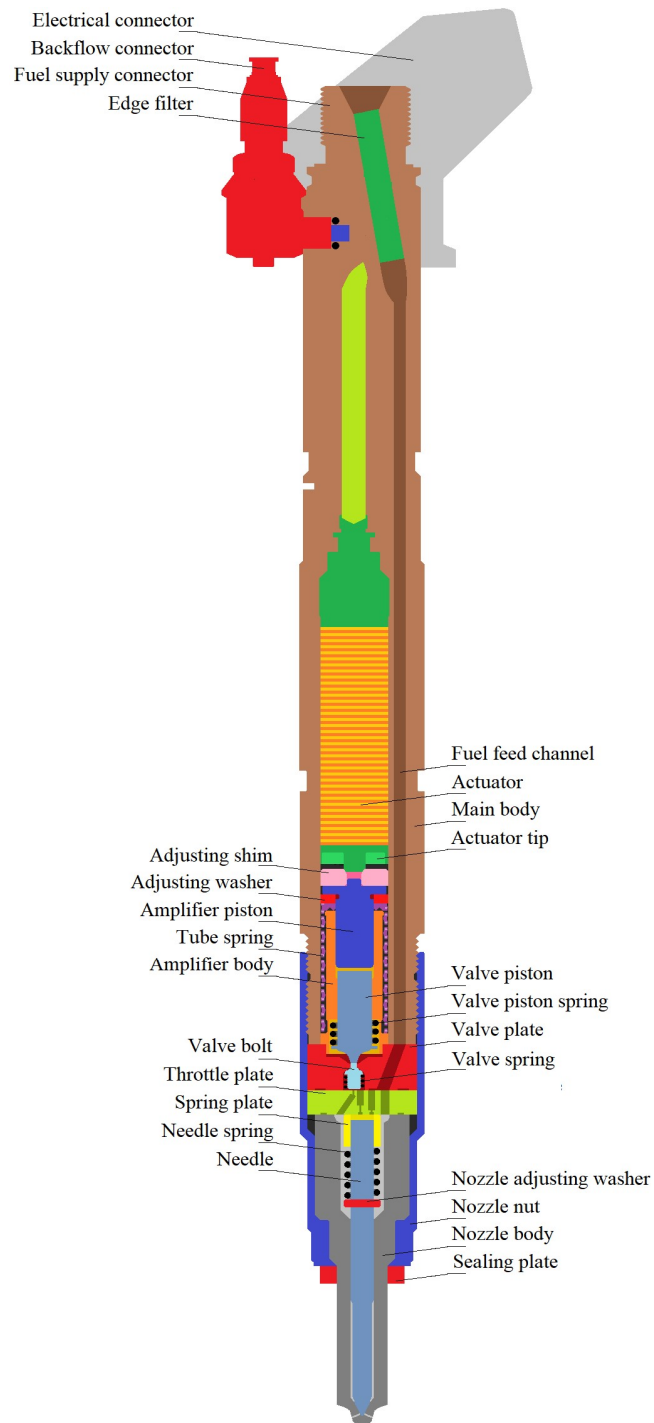

**9. Bosch CRI3-16 fuel injector design**

*Source: own study based on [13, 17]*


**Tab. 3.** Results of the preliminary tests

*Source: own study*

Type of parameter	Nominal range	Result
Electrical measurements		
Piezo actuator resistance,	150-210	182

R [k $\Omega$ ]		
Piezo actuator capacitance, C [ $\mu$ F]	1.5-3.3	2.24
Flow measurements		
Maximum Load, VL [ml/min]	46.2 $\pm$ 6.5	37.9
Emission Point, EM [ml/min]	18.7 $\pm$ 4.3	16.2
Pre-injection, VE [ml/min]	1.8 $\pm$ 1.5	0.9
Idle, LL [ml/min]	3.1 $\pm$ 2.7	2.2

Electrical tests ruled out permanent failure of the piezoelectric actuator, as its resistance and capacitance fell within the manufacturer's specified ranges. However, preliminary flow tests revealed an incorrect value of the full-load dose VL (Table 3). Therefore, a decision was made to disassemble the components for detailed microscopic inspections. Corrosion was observed on most fuel-contacting elements, and traces of abrasive wear were identified on selected working surfaces (Figure 10). As a result, the complete nozzle assembly, valve, and hydraulic transducer were replaced.

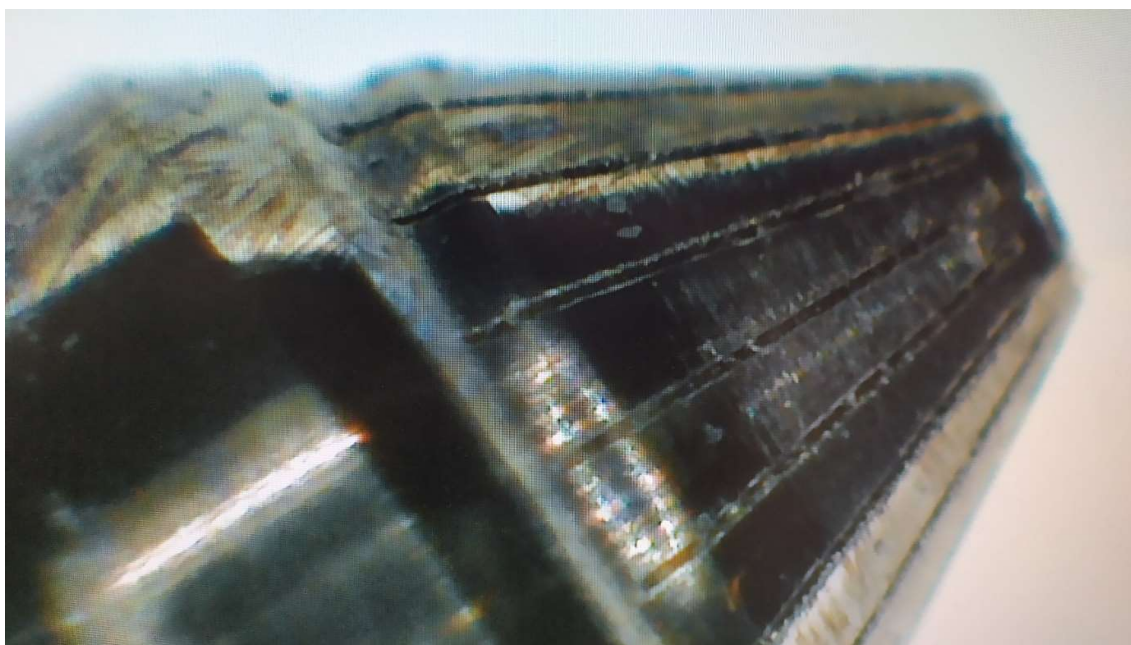


**10.** Example of corrosion and needle wear  
*Source: own study*

**Tab. 4.** Results of the main tests  
*Source: own study*

Type of parameter	Nominal range	Result
Maximum Load, VL [ml/min]	46.2 $\pm$ 6.5	43.9
Emission Point, EM [ml/min]	18.7 $\pm$ 4.3	19.2

Pre-injection, VE [ml/min]	1.8±1.5	1.7
Idle, LL [ml/min]	3.1±2.7	3.9

The performed actions proved to be insufficient as the fuel delivery was still not correct. It was decided that intervention in the hydraulic converter would be necessary to ensure the required length compensation. In the absence of support from the manufacturer, who does not provide repair technology or specific selection group shims, the surface of the front face of the element was ground down by 0.25 mm. From the data presented in Table 4, it can be concluded that the regeneration of the tested injector was successful, as the main flow tests yielded results within the nominal ranges (Figure 11). Furthermore, the applied adjustment method had an impact on increasing the values of all fuel doses, not just at the intended operating point. In this regard, the decision to replace the valve group is also significant, as the sealing integrity of the valve group was compromised during the long-term operation of the injector.

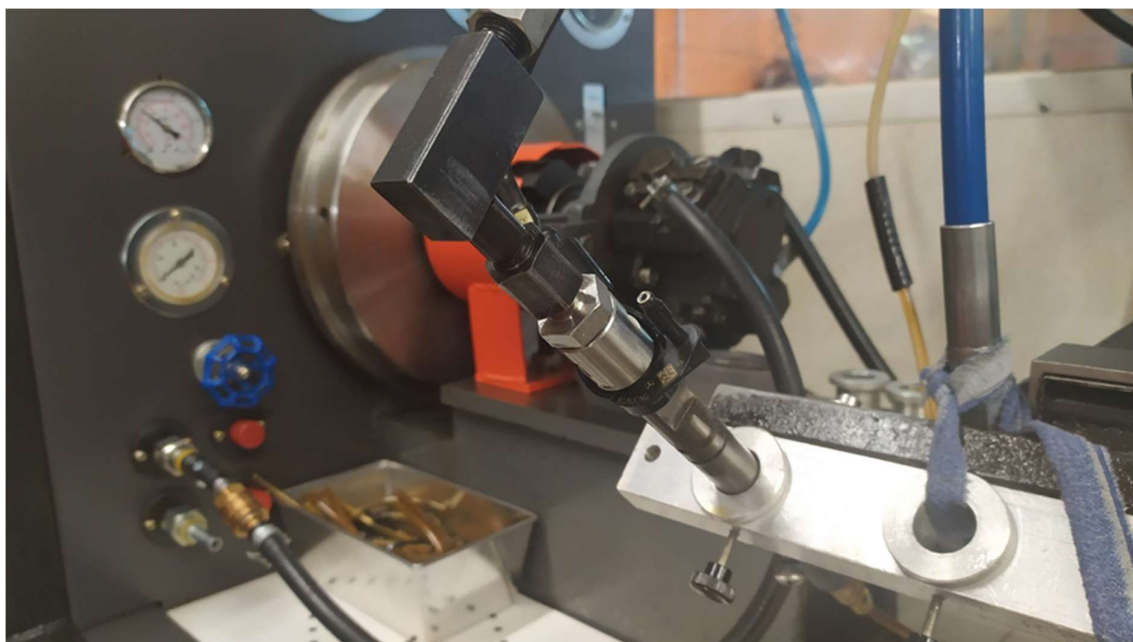

11. Testing of the Bosch CRI3-16 injector on the 12PSB test bench with the Stardex set  
*Source: own study*

In injectors with lower mileage, there is also a possibility to adjust the stack extension in the final coding phase. This process, similar to flow testing on the test bench, is conducted automatically. Shifting the operating range only requires finding a higher threshold voltage at which the crystal reaction and its interaction with the main control valve occur [7]. Consequently, the obligatory assignment of a new ISA code (German: Injektor-Spannungs-Abgleich) serves as a corrective action, supplementing the information regarding fuel metering in the IMA code (German: Injektor-Mengen-Abgleich) [9].

### Conclusion

Undoubtedly, a significant benefit of regeneration is cost reduction, which, when combined with the assurance of required quality, presents an interesting alternative to brand-new products. In a broader context, this process plays a crucial role in shaping the image and pro-environmental policy, constituting an essential element of a closed-loop economy. This is

particularly important regarding high-pressure fuel injection systems, considering the dominant presence of vehicles equipped with compression-ignition engines in commercial transportation. For these reasons, it is highly significant to eliminate inhibiting barriers associated with the lack of crystal stack replacement technology and access to original spare parts. This will enable the regeneration of piezoelectric injectors to be conducted practically to its full extent, similar to what has been achieved with electromagnetically controlled solutions, which have undergone three repair stages over the years. The first step has already been taken, as devices are currently available in the market that enable comprehensive assessment of their technical condition and the performance of necessary diagnostic tests.

Currently, 4-pin injectors, such as the Bosch CRIN 4.2, have started to be repaired after their warranty period has expired. These systems are characterized by an additional hydraulic reinforcement called HADI (Hydraulically Amplified Diesel Injector), allowing them to deliver fuel at operating pressures of up to 270 MPa. They were introduced into heavy-duty vehicle engines to meet the most stringent emission regulations, further improve performance, and enhance fuel efficiency. Consequently, it can be expected that 3rd generation piezoelectric injectors, which are the main focus of this article, will receive significantly greater support from manufacturers, as well as increased utilization in commercial transportation.

### Source materials

- [1] Abramek K. F., Osipowicz T., Gołębiewski W., Kowalek S. Wpływ zanieczyszczeń paliwa na zużycie wybranych elementów układu Common Rail. *Autobusy: technika, eksploatacja, systemy transportowe*, 2014, 5, 33-36
- [2] ACEA. *Vehicles in use Europe 2023*. European Automobile Manufacturers' Association, 2023, 1-21
- [3] Aleksandrowicz P. Analiza możliwości optymalizowania kosztów eksploatacji samochodów dostawczych. *Autobusy: technika, eksploatacja, systemy transportowe*, 2016, 6, 740-744
- [4] Czajka J., Pielecha I., Wisłocki K. A comparative analysis of diesel fuel injection parameters in piezoelectric and electromagnetic fuel injectors. *Combustion Engines*, 2009, 138(3), 54-63, <https://doi.org/10.19206/CE-117177>
- [5] Egger K., Warga J., Klügl W. New common rail injection system with piezo actuation for diesel passenger cars. *MTZ worldwide*, 2002, 63(9), 14-17
- [6] Hao S., Huang Y., Zhang S. Research on the drive system of piezoelectric injector. *Advances in Engineering Research*, 2017, 100, 98-102, <https://doi.org/10.2991/icmeim-17.2017.19>
- [7] Kaczorowski M., Pilewski Z. Kodowanie IMA/ISA wtryskiwaczy piezoelektrycznych. *Bosch Autospec*, 2017, 66(4), 7-9
- [8] Kaczorowski M., Pilewski Z. Wtryskiwacze piezoelektryczne – pionierzy wysokich ciśnień do 2500 barów. *Bosch Autospec*, 2017, 65(3), 7-10
- [9] Karpiuk W., Bor W., Smolec, R. Possibilities of Analysis of Condition and Repair of Common-Rail System Injectors. *Journal of KONES Powertrain and Transport*, 2018, 23(4), 209-216, <https://doi.org/10.5604/12314005.1217208>
- [10] Köten H., Gunes E.C., Guner K. Piezo-actuated common rail injector structure and efficient design. *Journal of Energy Systems*, 2018, 2(1), 97-114, <https://doi.org/10.30521/jes.453560>
- [11] Kurczyński D., Augustyński A. Analiza uszkodzeń wtryskiwaczy układów zasilania common rail. *Autobusy: technika, eksploatacja, systemy transportowe*, 2016, 12, 1097-1105
- [12] Lee Y., Lee C. H. Development of diesel piezo injector driver using microcontrollers. *ARPN Journal of Engineering and Applied Sciences*, 2018, 13(18), 4860-4865

- 
- [13] Liu Z., Liu N., Liu J. Study of the Influencing Factors on the Small - Quantity Fuel Injection of Piezoelectric Injector. *Micromachines*, 2022, 13(813), 1-20, <https://doi.org/10.3390/mi13050813>
- [14] Meng Y., Chen G., Huang M. Piezoelectric Materials: Properties, Advancements, and Design Strategies for High-Temperature Applications. *Nanomaterials*, 2022, 12(1171), 1-32, <https://doi.org/10.3390/nano12071171>
- [15] Nouraei H., Ben-Mrad R., Sinclair A. N. Development of a Piezoelectric Fuel Injector. *IEEE Transactions on Vehicular Technology*, 2016, 65(3), 1162-1170, <https://doi.org/10.1109/TVT.2015.2410136>
- [16] Pilewski Z. Regenerowane wtryskiwacze Common Rail do samochodów osobowych i dostawczych – BX. *Bosch Autospec*, 2014, 51(3), 8-9
- [17] Salvador F.J., Plazas A.H., Gimeno J., Carreres M. Complete modelling of a piezo actuator last generation injector for diesel injection systems. *International Journal of Engine Research*, 2014, 15(1), 3-19, <https://doi.org/10.1177/1468087412455373>
- [18] Satkoski C.A., Shaver G.M., More R., Meckl P., Memering D. Dynamic Modeling of a Piezoelectric Actuated Fuel Injector. *IFAC Proceedings Volumes*, 2009, 42(26), 235-240. <http://doi.org/10.3182/20091130-3-FR-4008.0048>
- [19] Shashank M. Piezoelectric diesel injectors & emission control. *International Journal of Science and Research*, 2015, 4(1), 1-3